



## GV-VMS Version History

### Version 17.1.0.100

#### New:

- Support for new GV-IP devices (Patch V17.1.0.012)
  - GV-ABL2702 / ABL8712
  - GV-AVD2700 / AVD8710
  - GV-EBD8711
  - GV-SD2301 V2 / GV-SD2411 V2

#### Improved:

- Compliance with the European Union's General Data Protection Regulations (GDPR) (Patch V17.1.0.002)

#### Fixed:

- System behaving abnormally after manually adding the upgraded GV-BX2600 firmware version V101\_1080321 on IP Device Setup (Patch V17.1.0.010)
- Random failure to receive camera image when multiple GV-Edge Recording Managers are connected to GV-VMS simultaneously after the Use Sub Stream FIFO function is enabled on CMS Server (Patch V17.1.0.001)
- Camera connection failure if over 64 channels are connected through RTSP protocol simultaneously (Patch V17.1.0.003)
- Chinese I/O names of GV-IO Box 4E appearing gibberish on the Content List of GV-VMS traditional Chinese language version (Patch V17.1.0.007)
- Repeated watchdog errors upon the system reboot after Wide Angle is selected from Camera Lens settings (Patch V17.1.0.010)
- Blurry image display of a camera when it is switched from a multi-channel division to single-channel division, changed to single stream or has Focus View enabled, after selecting Wide Angle from Camera Lens settings (Patch V17.1.0.010)



- Blurry image display if the camera channel is opened in the Advanced Motion Detection dialog box under the multi-channel division and then switched to a single-channel division (Patch V17.1.0.010)
- Inability to switch to sub stream after the camera channel is opened in the Advanced Motion Detection dialog box under the single-channel division (Patch V17.1.0.010)
- Failure to record motion events after the motion recording function becomes stagnant over a prolonged period of time (Patch V17.1.0.009)
- Inability to filter out “scene change” events through Event List Query on WebCam Server (Patch V17.1.0.008)
- Privacy Mask feature becoming inapplicable to recorded clips through WebCam Server on non-IE browsers (Patch V17.1.0.004)
- Inability to apply “clean time” and “transaction end dwell time” settings when setting up POS text overlay (Patch V17.1.0.011)
- Inability to display corresponding system logs on GV-Vital Sign Monitor when the camera is disconnected or re-connected (Patch V17.1.0.006)